



深圳升创国际物流有限公司
SAN LOGISTICS LIMITED
深圳市罗湖区桂都大厦 1705 室
Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen
TEL:0755 8233 5681 www.sanlogistics.cn

Inspection Report (☒ 1 ST ☐ 2 ND)		PENDING	
☒ Pre-shipment ☐ ON-LINE ☐ IN PROCESS ☐ FULL			
Summary Section		Service Number: F-QC202007102507	
		Product Name	Portable Sanitizer Dispenser
		Item number	DT-SP1
		P/O number	---
		Quantity	3000pcs
		Client name	---
		Supplier name	---
		Inspection date	2020.7.10
		Arrival time	13:30pm
		Departure time	16:00pm
		Inspection location	Shenzhen Guangdong China
Inspector	Donald		

Category	Conform		Comment
1. Quantity	☒ YES	☐ NO	
2. Product description / style / color	☐ YES	☒ NO	Special Attention 2
3. Workmanship	☒ YES	☐ NO	
4. Testing/ checking	☒ YES	☐ NO	
5. Data measurement	☐ YES	☒ NO	Special Attention 3
6. Packaging	☒ YES	☐ NO	
7. Marking	☒ YES	☐ NO	

OVERALL CONCLUSION	PENDING
	Pending client review and approval



Special Attention

- 1, No approval sample checking with mass product. Please refer to the picture in report.
- 2, Product actual without battery, but product manual said have batteries.



3. The carton weight actually is 13.7kg same as printing on the shipping mark, but different with the request.

Measurement: 0.0305 ctns/ctn, in total: 0.3475 ctns
Gross Weight: 17.3kg/ctn, In total: 259.5kg

Defective products ☒ pick out ☐ replace ☐ rework

DETAILS

I. Quantity

Item Number	Ordered Quantity	Total carton	Packed Quantity	Finished quantity	Not finished quantity	Sample from packed Qty.	Sample from Not packed Qty.
DT-SP1	3000	15	3000	3000	0	125	0

II. Product description / style / color

1. Product description





深圳升创国际物流有限公司
SAN LOGISTICS LIMITED
深圳市罗湖区桂都大厦 1705 室
Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen
TEL:0755 8233 5681 www.sanlogistics.cn





Capacity test



Capacity test



20ml



Assembly test



Function test(spraying)



Function test(spraying)



Function test(spraying)



Function test(spraying)

2. Dimensions




Size measurement



Size:107mm



Size measurement

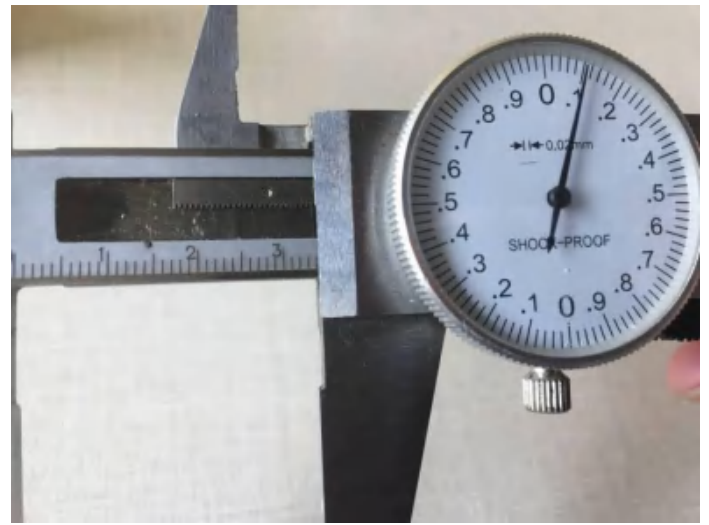

Size:35mm



Size measurement



Size:35mm

III. Workmanship

Inspection Standard: ANSI/ASQZ1.4 (MIL-STD-105E)		DEFECTS		
		Critical	Major	Minor
Sampling plan: Single, Normal	AQL	0.0	2.5	4.0
Inspection Level: II	Defects Found:	0	1	3
Sample Size:	125pcs	0	7	10
	Max. Allowed:	0	7	10

Defectives List				
Defectives Description		CRI	MAJ	MIN
1.	The battery cover assembly no smooth	0	1	0
2.	Black point on housing	0	0	1
3.	Dirty mark on housing	0	0	1
4.	Scratch mark on plastic bottle	0	0	1



Defectives PIC



The battery cover assembly no smooth



Black point on housing



Dirty mark on housing



Scratch mark on plastic bottle

V. Data measurement

List of test data

Item	Contract requirements	Measured data
Carton size	39*39*27cm	39*39*24cm
G.W.	17.3kg/13.78kg	13.7kg
Color box size	N/A	3.6*3.6*11cm
G.W.	N/A	65g
N.W.	N/A	56g



深圳升创国际物流有限公司

SAN LOGISTICS LIMITED


深圳市罗湖区桂都大厦 1705 室

Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen

TEL:0755 8233 5681

www.sanlogistics.cn

Pictures & instructions

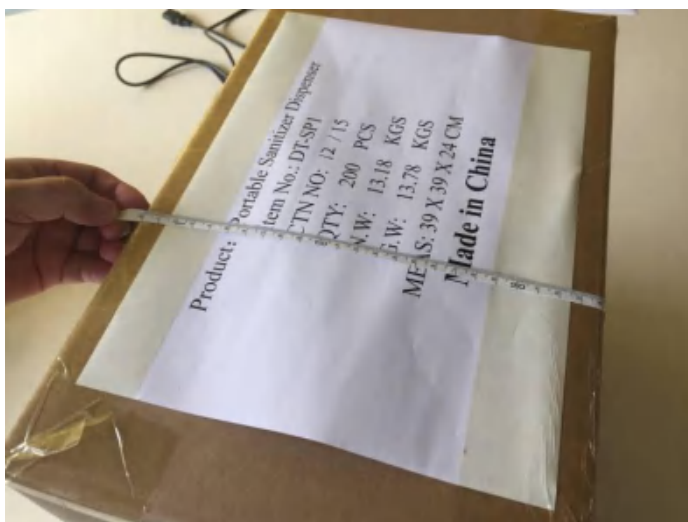



深圳升创国际物流有限公司



SAN LOGISTICS LIMITED

深圳市罗湖区桂都大厦 1705 室

Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen

TEL:0755 8233 5681

www.sanlogistics.cn

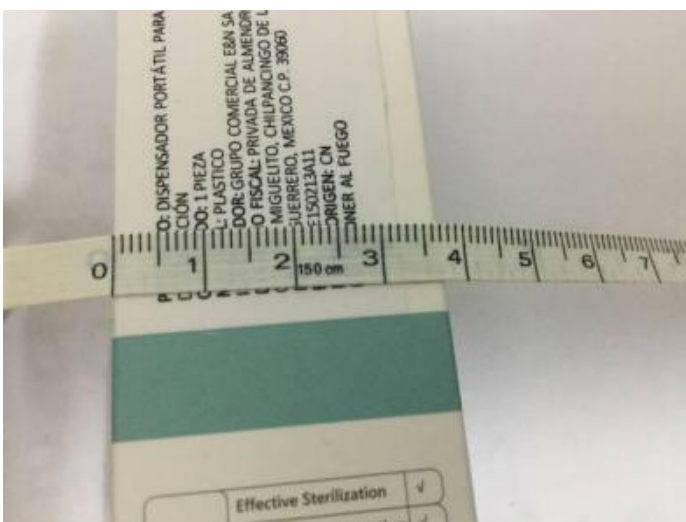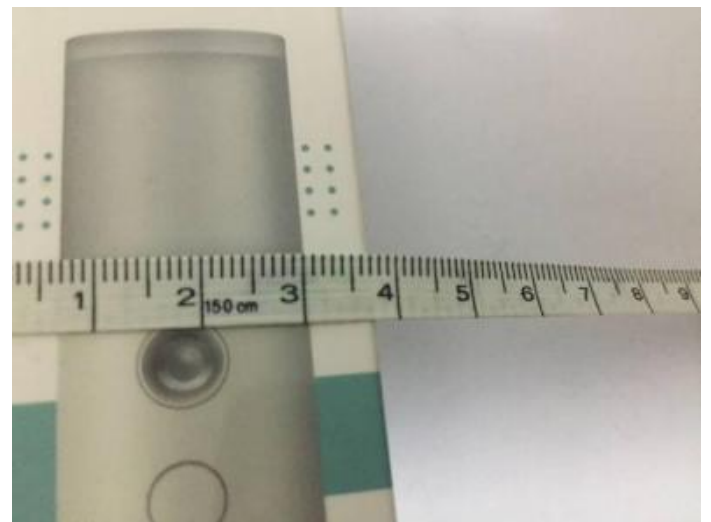



深圳升创国际物流有限公司

SAN LOGISTICS LIMITED

深圳市罗湖区桂都大厦 1705 室

Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen

TEL:0755 8233 5681

www.sanlogistics.cn





深圳升创国际物流有限公司
 SAN LOGISTICS LIMITED
 深圳市罗湖区桂都大厦 1705 室
 Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen
 TEL:0755 8233 5681 www.sanlogistics.cn

VI. PACKING

PACKING





深圳升创国际物流有限公司


SAN LOGISTICS LIMITED

深圳市罗湖区桂都大厦 1705 室

Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen


TEL:0755 8233 5681

www.sanlogistics.cn

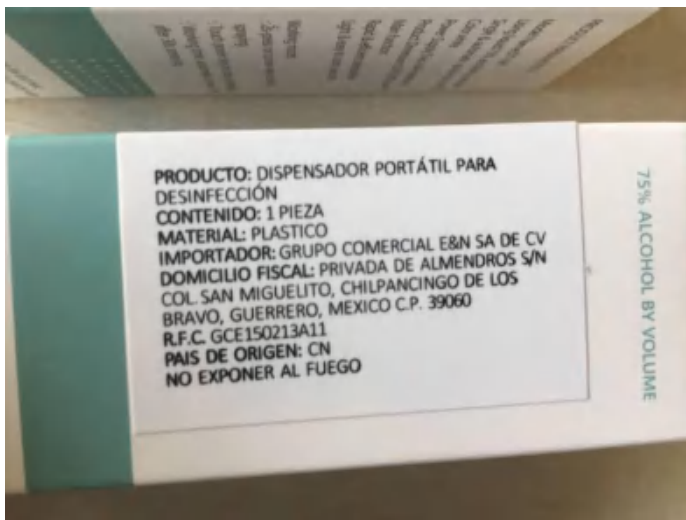



深圳升创国际物流有限公司
SAN LOGISTICS LIMITED
深圳市罗湖区桂都大厦 1705 室
Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen
TEL:0755 8233 5681 www.sanlogistics.cn

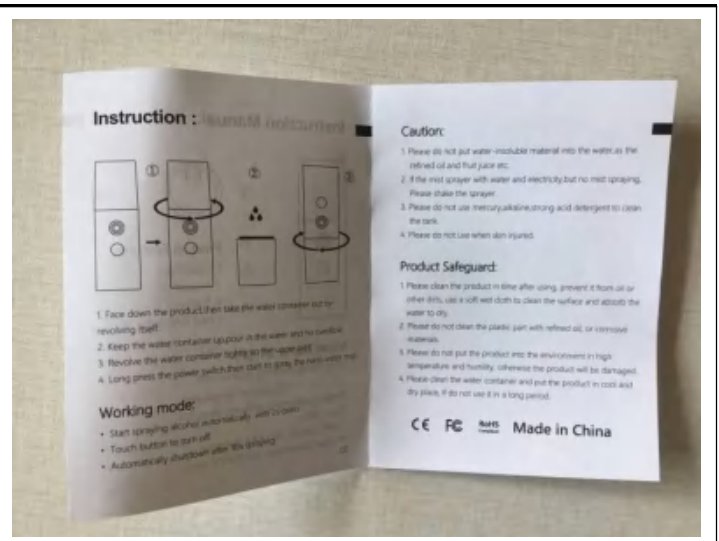

VII. MARKING

SHIPPING MARK



Inspection spot





深圳升创国际物流有限公司

SAN LOGISTICS LIMITED

深圳市罗湖区桂都大厦 1705 室

Room 1705.Guidou Building Chunfeng Road Luohu. Shenzhen

TEL:0755 8233 5681

www.sanlogistics.cn

Note: This report reflects our findings at time and place of inspection.

This report does not relieve suppliers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter.

-----END OF REPORT-----